



This Service Information bulletin supersedes Service Measure M51 200 04 **dated April 2004.**

SUBJECT**Glove Box Difficult to Latch or Open****MODEL**

R50 (Cooper) and R53 (Cooper S)

SITUATION

Glove box is difficult to latch or pops open on rough roads.

CAUSE

The glove box latch does not sufficiently engage the striker.

CORRECTION

Move the striker downward for more positive engagement of the latch into the striker.

PROCEDURE

- Remove the glove box.
- Install three A6.4, 1mm washers (P/N 88 10 0 141 709) on each of the T20 screws holding the top of the glove box (between the glove box and the blue plastic nuts).