

BMW Group - AIR: 2021-03-13 / 11:45
 Dealer: 32711/06
 Model: Cooper
 Vehicle identification number: WMWZB3C50CWM29955
 Development code: R60
 Model code: ZB33
 Lead type: ZB33

[Removing and installing/sealing cylinder head \(N16\)](#) » [Removing and installing or replacing the exhaust manifold \(N12, N16\)](#) » [Moving front panel into service position](#) »

Removing and installing/replacing front left acceleration sensor (US version only)


REP-REP-RAR5265-6577532_US - V.5

65 77 532 Removing and installing/replacing front left acceleration sensor (US version only)



Necessary preliminary work:

- Remove wheel arch cover at front

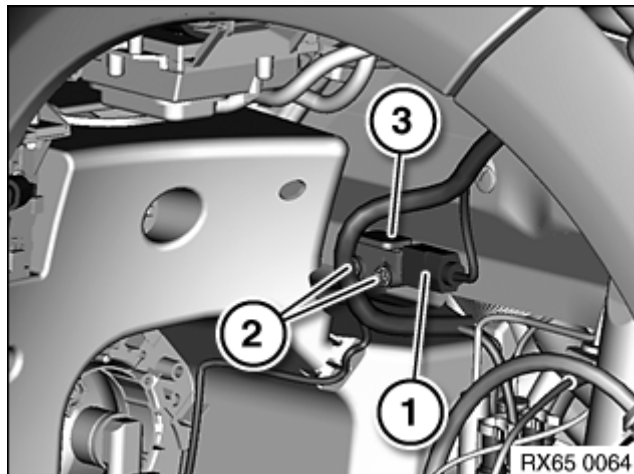

Disconnect plug connection (1).

Release screws (2) and remove acceleration sensor (3).

Installation note:

Replace screws (2). **6.6ftlb**

Tightening torque 65 77 4AZ .

Note:

The installation position of the acceleration sensor has been changed on vehicles built after 08/2010:

(1) Installation position before 08/2010

(3) Installation position after 08/2010

The acceleration sensor (3) is positioned slightly offset on the other side of support (2).

