

[Index for this BMW TSB](#)

SI M 61 01 06
General Electrical Systems

October 2006
Technical Service

SUBJECT

Washer Fluid Leaks from Rear Washer Jet

MODEL

R50 (Cooper) produced from 11/2003

R53 (Cooper S) produced from 11/2003

SITUATION

The customer may complain that washer fluid is leaking from the rear window washer jet.


CAUSE

Vacuum created while the vehicle is in motion can cause washer fluid to leak from the rear washer jet.

CORRECTION

In case of a customer complaint, install a non-return valve to the rear wiper motor.

PROCEDURE

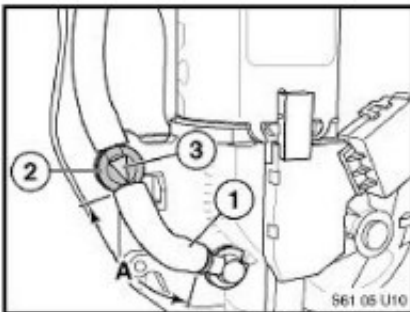

1. Cut the washer fluid supply hose (1) approximately 25mm from the end. (dimension A)
2. Install check valve (2) with the arrow (3) pointing toward the rear hatch wiper motor.

PARTS INFORMATION

| Part Number | Description | Quantity |
|-----------------|------------------|----------|
| 61 68 8 229 249 | Non-return valve | 1 |

WARRANTY INFORMATION

For information only.

[MINI, a division of BMW of North America, LLC

10/5/2006