

[ FFG WARR EXP ] 12/22/11 [ FFG WARRANTY TR ] IN1 1256720

LABOR & PARTS-----

J# 1 321MZALNCHECK ALIGNMENT CHECK HOURS: 1.00 TECH(S):1218 INTERNAL

OWNER STATES THAT VEHICLE IS PULLING TO THE RIGHT.  
 MINI OF ST. LOUIS RECOMMENDED CUSTOMER TO RETURN  
 TO ORIGINAL SELLER OF TIRES. TIRES HAVE BEEN SWAPPED  
 AND HAD NEW TIRES INSTALLED, STILL PULLING  
 tires causing 20lb pull to right  
 performed straight trac on balancer /found tires causing  
 excessive pull to right with no possible placement of tires  
 to have vehicle driving straight(due to tires being  
 directional)will need new set of tires. PROVIDED PRINTOUT OF  
 STRAIGHT TRAC TIRE READINGS. READINGS SHOW PULL/DRIFT TO  
 RIGHT FROM ORIGINAL POSITION OF TIRES. THERE IS NO  
 ALTERNATIVE POSITION THAT WILL ELIMINATE TIRE PULL DUE TO  
 TIRES BEING DIRECTIONAL TREAD PATTERN.  
 ALSO FELT VIBRATION ON TEST DRIVE AND FOUND R/F TIRE  
 SEVERELY OUT OF BALANCE (SEE PRINTOUT). BALANCED TIRES AND  
 SET ALL TO PROPER PSI.

PARTS-----	QTY----	FP-NUMBER-----	DESCRIPTION-----	UNIT PRICE-
				JOB # 1 TOTAL PARTS 0.0
				JOB # 1 TOTAL LABOR & PARTS 0.0
J# 2+001MZ6161041		VALUE SERVICE WIPERS	HOURS: TECH(S):1218	33.0
		replace front wipers not cleaning glass	\$53.95 plus tax	
		VALUE SERVICE WTPFDC		


Original position.

L/F #1

R/F #2

L/R #3

R/R #4

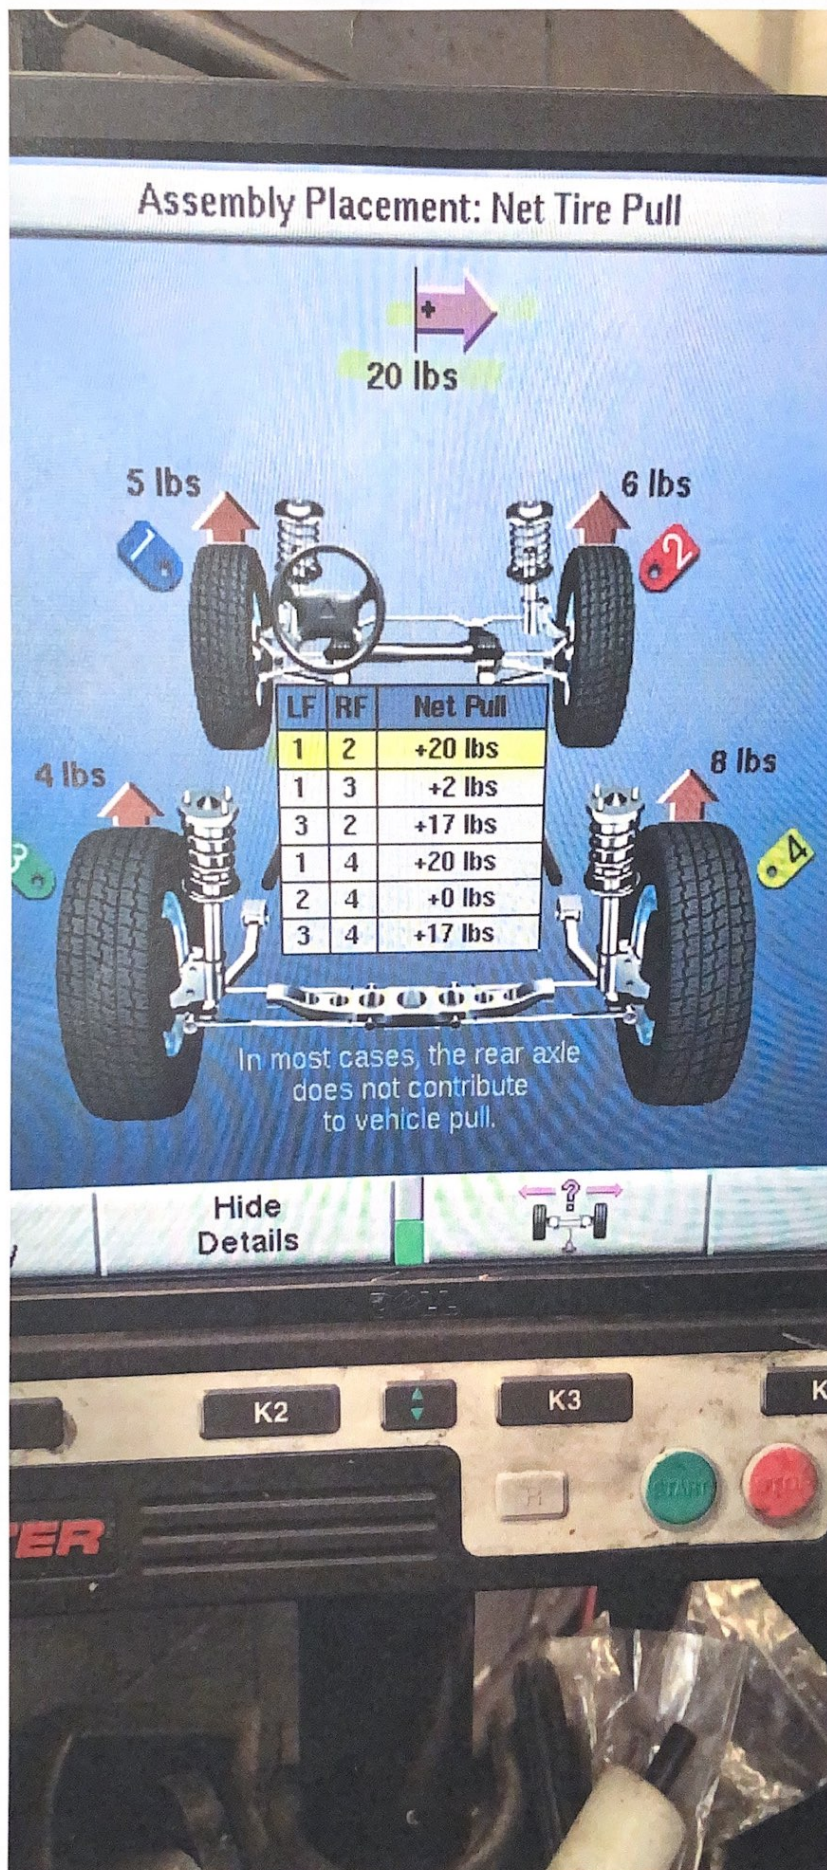


L/F #1

R/F #2

L/R #3

R/R #4

Original position.

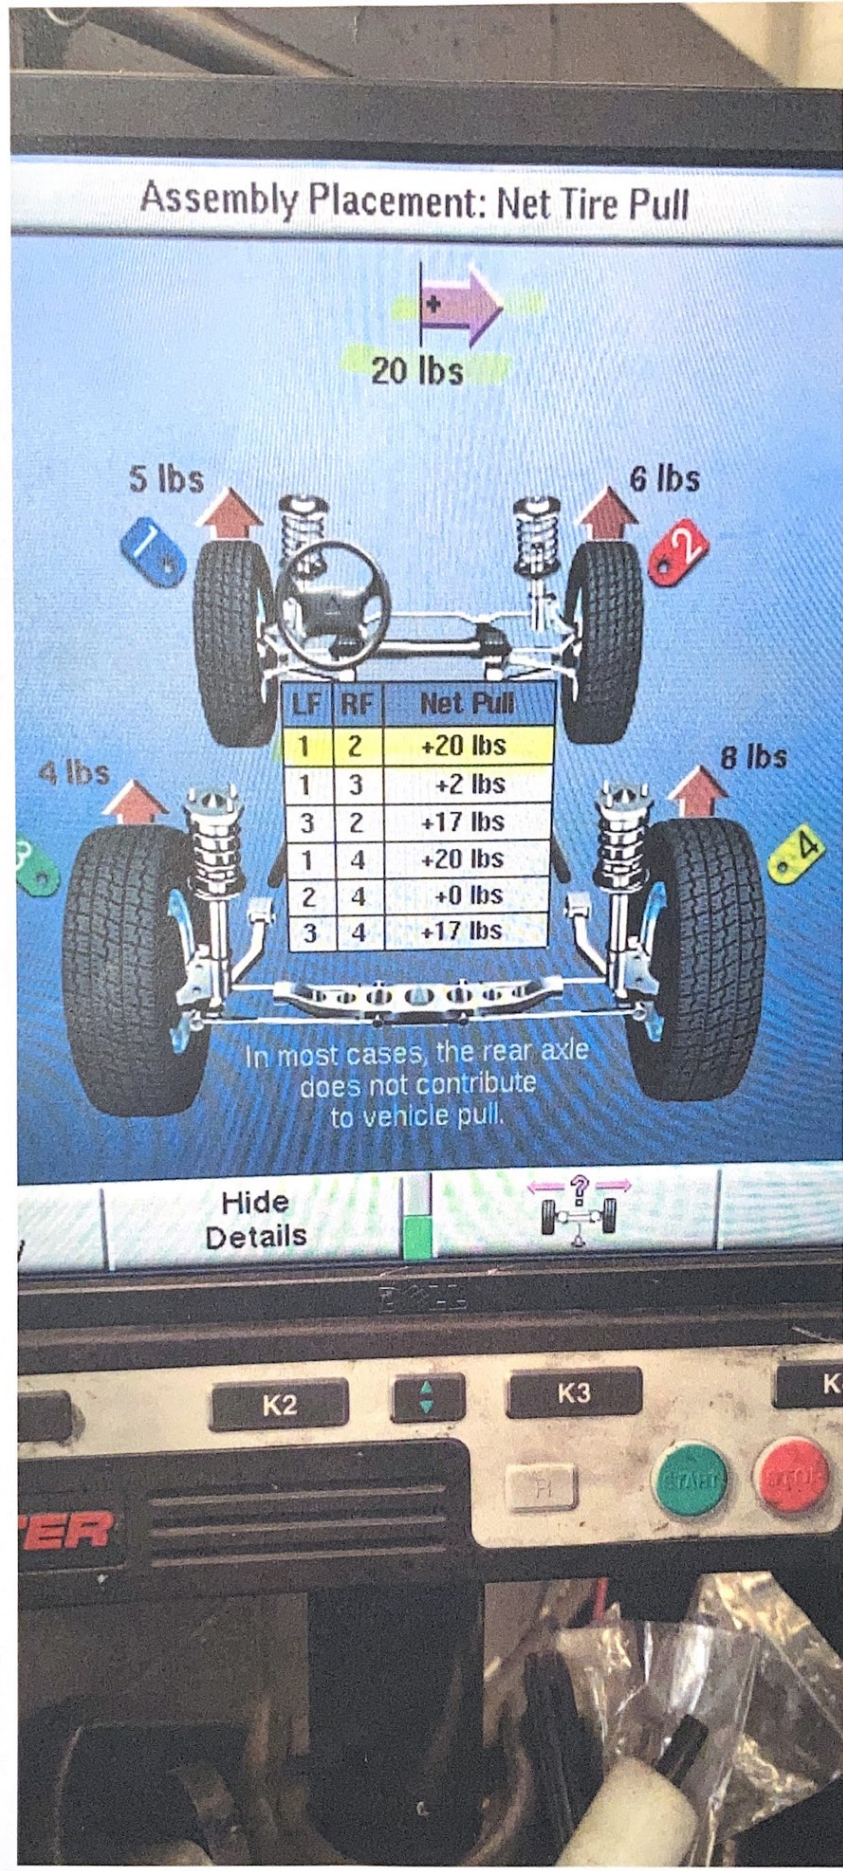

R/F  
tire

